

## RAVENSWOOD

**JACKSON CO** (I18) 6 SW UTC-5(-4DT) N38°55.79' W81°49.17'

CINCINNATI  
L-29B  
IAP

758 B NOTAM FILE EKN

**RWY 04-22:** H4000X75 (ASPH) S-12.5 MIRL 0.5% up NE

**RWY 04:** REIL. PAPI(P2L)—GA 3.0° TCH 50'. Trees.

**RWY 22:** REIL. PAPI(P2L)—GA 4.0° TCH 50'. Trees.

**SERVICE:** S4 **FUEL** 100LL **LGT** ACTVT REIL Rwy 04 and 22, PAPI Rwy 04 and 22; MIRL Rwy 04-22 and windsock lgt—CTAF. VGSi and descent angles not coincident.

**AIRPORT REMARKS:** Attended 1300-2100Z. Parachute Jumping. Deer and birds on and invof arpt. +482' stack 1/2 mile NW of arpt. 15' trees parallel to Rwy 04, 75' left of centerline. Rwy 04-22 has over 50' drop-off 200' fm thr on each end.

**AIRPORT MANAGER:** 304-273-8114

**WEATHER DATA SOURCES:** AWOS-2 121.3 (304) 273-3424.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

Ⓡ HUNTINGTON APP/DEP CON 128.4

**CLEARANCE DELIVERY PHONE:** For CD ctc Huntington ATCT at 304-453-2490.


**RADIO AIDS TO NAVIGATION:** NOTAM FILE EKN.

**HENDERSON (H) DME** 115.9 HNN Chan 106 N38°45.25'

W82°01.57' 043° 14.3 NM to fld. 880.

DME unusable:

185°-290° blo 4,500'

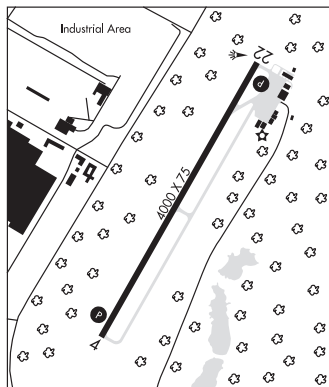

**RICHWOOD MUNI** (314) 6 W UTC-5(-4DT) N38°15.50' W80°39.08'

CINCINNATI  
L-261

2486 NOTAM FILE EKN

**RWY 10-28:** H3360X60 (ASPH) 2.1% up E

**RWY 10:** Trees.

**RWY 28:** Trees.

**AIRPORT REMARKS:** Unatndd. Arpt CLOSED ngts. Deer and birds on and invof arpt. Arpt gate locked. Call amgr for access. Rwy 10-28 no snow removal. Rwy frequently snow covered winter months. Rwy 10-28 soft shoulders. Rwy 10-28 pavement cracks with vegetation.

**AIRPORT MANAGER:** 304-618-3611

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Washington ARTCC at 703-771-3587.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE BKW.

**BECKLEY (H) (DH) VORW/DME** 117.7 BKW Chan 124 N37°46.82'


W81°07.41' 044° 36.4 NM to fld. 2517/6W.

DME unusable:

080°-215° byd 15 NM

VOR unusable:

070°-200°

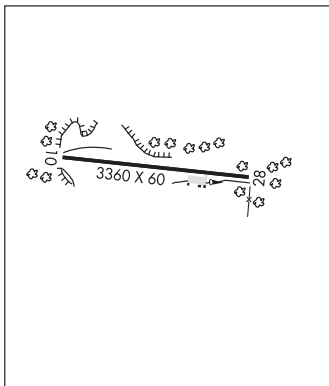

**ROBERT NEWLON FLD** (See HUNTINGTON on page 389)

## SHINNSTON

**WADE F MALEY FLD** (6WØ) 1 NE UTC-5(-4DT) N39°24.37' W80°16.61'

CINCINNATI

997 NOTAM FILE EKN

**RWY 05-23:** 2265X45 (TURF) 0.9% up NE

**RWY 05:** Trees.

**RWY 23:** Ground. Rgt tfc.

**SERVICE:** S2

**AIRPORT REMARKS:** Unattended. Deer on and invof arpt. Rwy 23: 15' drop-off 10' from thld OB. Rwy 05: 20' drop-off 15' from thld OB. High terrain all quadrants. Rwy 05-23, 20' pwr poles midpt of rwy, 65' L and R of cntrln. 400' ridge/trees 1,100' from thld Rwy 23 OB. 15' drop-off 45' from centerline full length both sides of rwy. Act parked 55' W of rwy centerline, approximately 1,000' N of Rwy 05 end. Apch Rwy 23 from northwest, depart Rwy 05 to northwest due to ridge northeast of arpt. Power Plant-2 stacks, 1979 MSL, 1009 AGL, 3 mi SW.

**AIRPORT MANAGER:** 304-641-8406

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Clarksburg Apch at 304-842-2011, when Apch clsd ctc Cleveland ARTCC at 440-774-0226.