

BOLIVAR

BAR V K (T38) P 1 N UTC-6(-5DT) N33°22.58' W97°14.61'

DALLAS—FT WORTH

765 NOTAM FILE FTW

RWY 18-36: 2900X100 (TURF) LIRL

RWY 18: Thld dsplcd 200'. Road.

RWY 36: Thld dsplcd 200'. Trees.

SERVICE: LGT ACTVT LIRL Rwy 18-36—122.825.

AIRPORT REMARKS: Unattended. Arpt clsd at ngt to non-residents. Wildlife on and invof rwy. Glider actvt on and invof arpt.

PAEW on rwy. Grass mower will clear rwy aft low apch. No fuel or otr svcs avbl. Do not mistake north end 1400 ft long turf twy as rwy. Rwy soft when wet, call for ficons. Cell twr midfield inside downwind for Rwy 36. Ditch on both sides of rwy mid field outside of rwy lgts.

AIRPORT MANAGER: 940-453-5256

COMMUNICATIONS: CTAF 122.85

CLEARANCE DELIVERY PHONE: For CD ctc Regional Apch at 972-615-2799.

BONHAM

JONES FLD (F00) 2 N UTC-6(-5DT) N33°36.79' W96°10.76'

DALLAS—FT WORTH

618 B NOTAM FILE FTW

L-17D, A

RWY 17-35: H4000X75 (ASPH) S-12.5 MIRL

IAP

RWY 17: PAPI(P2L)—GA 3.0° TCH 37'. Trees.

RWY 35: PAPI(P2L)—GA 3.0° TCH 37'. Antenna.

SERVICE: S4 FUEL 100LL, JET A+ LGT MIRL Rwy 17 and 35 SS-SR preset low; to ACTVT or incr instst—CTAF. PAPI Rwy 17 and PAPI Rwy 35 opr consly.

AIRPORT REMARKS: Unattended. For arpt attendant call 903-583-7555 Mon-Fri 1400-2300Z. Aft hrs call Bonham Police Dept.

903-583-2141. 100LL self-serv. Jet A full serv. Call 903-227-5199. Extensive aerial AG ops Apr-Aug. Otr times ireg. For airframe repairs call 903-640-0233 or 903-583-5119.

AIRPORT MANAGER: 903-583-8623

WEATHER DATA SOURCES: AWOS-3PT 118.05 (903) 583-2082.

COMMUNICATIONS: CTAF/UNICOM 122.8


® FORT WORTH CENTER APP/DEP CON 127.6

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE FTW.

BONHAM (VH) (H) VORTAC 114.6 BYP Chan 93 N33°32.25' W96°14.05' 025° 5.3 NM to fld. 700/6E.

COMM/NAV/WEATHER REMARKS: UNICOM unmonitored.

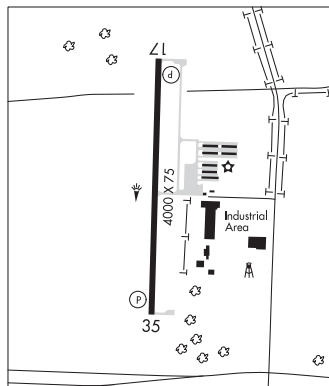

BORGER

HUTCHINSON CO (BGD)(KBGD) 2 N UTC-6(-5DT) N35°42.05' W101°23.62'

DALLAS—FT WORTH

3055 B NOTAM FILE BGD

H-6G, L-15B

RWY 17-35: H6299X100 (ASPH) S-60, D-100 MIRL 0.9% up S

IAP

RWY 17: PAPI(P4L)—GA 3.0° TCH 58'. Pole.

RWY 35: PAPI(P4R)—GA 3.0° TCH 41'. Trees.

RWY 03-21: H3897X100 (ASPH) S-60, D-100 MIRL 0.5% up SW

SERVICE: FUEL 100LL, JET A+ LGT ACTVT PAPI Rwy 17 and 35; MIRL Rwy 03-21 and 17-35—CTAF.

AIRPORT REMARKS: Attended 1400-0000Z. Rwy 21, 100' drop-off, 95' dstc. Rwy 3, 40' drop-off, 150' dstc.

AIRPORT MANAGER: 806-273-0137

WEATHER DATA SOURCES: ASOS 118.325 (806) 274-7318.

COMMUNICATIONS: CTAF/UNICOM 123.0

® AMARILLO APP/DEP CON 119.5 (1200-0600Z)

® ALBUQUERQUE CENTER APP/DEP CON 127.85 (0600-1200Z)

CLEARANCE DELIVERY PHONE: For CD ctc Albuquerque ARTCC at 505-856-4861.

RADIO AIDS TO NAVIGATION: NOTAM FILE BGD.

BORGER (L) TACAN Chan 23 BGD (108.6) N35°48.42' W101°22.93' 174° 6.4 NM to fld. 3130/11E.

TACAN AZIMUTH unusable:

220°-320° byd 10 NM blo 12,000'

