

**RAMONA** (RNM)(KRNM) 2 W UTC-8(-7DT) N33°02.35' W116°54.92'

LOS ANGELES

1395 B TPA—See Remarks NOTAM FILE RNM

H-41, L-4H

**RWY 09-27:** H5001X150 (ASPH) S-75, D-95, 2D-170 MIRL

IAP, AD

**RWY 09:** PAPI(P2L)—GA 3.5° TCH 51'.

**RWY 27:** REIL. PAPI(P2L)—GA 3.5° TCH 32'.

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** ACTIVATE REIL Rwy 27, MIRL Rwy 09-27 and twy lghts—CTAF. PAPI Rwy 09 and Rwy 27 operates 24 hrs. Rwy 09 VGS1 unusbl byd 3 NM due to terrain.

**NOISE:** Voluntary jet curfew 0600-1500Z±. Noise sensitive are NE-SE. Noise abatement, tkf climb on rwy heading until 1900' MSL.

**AIRPORT REMARKS:** Attended 1600-0400Z±. Be alert for birds year round, various size and species. Ocnl coyote on or invof of rwy and twy. PPR for all military acft ctc arpt manager. Repetitive copter trng conducted on helipads south of rwy and Twy A west of tower. West tsnt ramp adj to ATCT rstrd to acft less than 12500 lbs. Fire fighting acft on and invof arpt. Air tankers in vicinity year-round frequently fly nstd pattern entries. TPA—2395(1000) single engine, 2895(1500) multi-engine. For fire fighting activity call arpt manager. Rwy 27 calm wind rwy.

**AIRPORT MANAGER:** 760-788-3366

**WEATHER DATA SOURCES:** ASOS (760) 789-7699

**COMMUNICATIONS:** CTAF 119.875 ATIS 132.025 UNICOM 122.95

Ⓡ **SOCAL APP CON** 132.2

**TOWER** 119.875 (1600-0400Z±) **GND CON** 121.65

Ⓡ **SOCAL DEP CON** 127.3

**CLEARANCE DELIVERY PHONE:** For CD when ATCT clsd ctc SoCal Apch at 800-448-3724.

**AIRSPACE:** CLASS D svc 1600-0400Z±; other times CLASS G.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SAN.

**JULIAN (VL) (L) VORTACW** 114.0 JLI Chan 87 N33°08.43' W116°35.16' 235° 17.7 NM to fld. 5560/15E.

VOR unusable:

007°-010° byd 40 NM

336°-339° byd 40 NM

344°-355° byd 40 NM


356°-006° byd 40 NM blo 14,500'

356°-006° byd 70 NM

**COMM/NAV/WEATHER REMARKS:** When twr clsd acft must self-announce on CTAF prior to ldg or tkof.

**HELIPAD H1:** H340X66 (ASPH-CONC)

**HELIPORT REMARKS:** Helipad parking N of rwy not open to public. Helicopter skid llds on rwy and twy prohibited. Helipad ops to helipad south of rwy restricted to 6,000 lbs or less. Helipad S of rwy unlgtd. Helipad S of rwy daytime VFR use only.

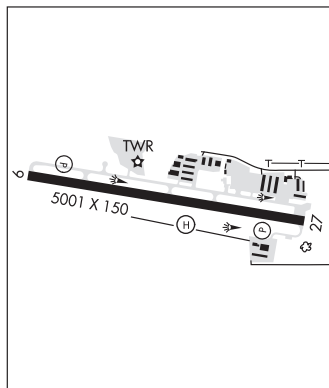

**RANCHO MURIETA** (RIU)(KRIU) 1 W UTC-8(-7DT) N38°29.21' W121°06.17'

SAN FRANCISCO

144 TPA—944(800) NOTAM FILE RIU

L-2F, 3A

**RWY 04-22:** H3798X75 (ASPH)

**RWY 04:** VASI(V2L)—GA 3.0° TCH 12'. Road. Rgt tfc.

**RWY 22:** VASI(V2L)—GA 3.0° TCH 12'. Tree.

**SERVICE:** **FUEL** 100LL, JET A **LGT** Rwy 04 VASI OTS indef. Arpt lghts opr 1600-0100Z±.

**NOISE:** Rwy 22 noise abatement procedures in effect, ctc arpt manager 916-354-2940.

**AIRPORT REMARKS:** Attended 1600-0100Z±. Deer on and invof rwy. +30' obstruction lit power poles parallel to Rwy 04-22.

All ultralights must comply with FAR 103 and have an operating acft radio. All transient acft rprd to park in designated transient area. Ldg fees apply. Pstn single \$25, pstn twin \$40, turbo prop \$75, jet \$100.

**AIRPORT MANAGER:** 916-354-2940

**COMMUNICATIONS:** CTAF/UNICOM 122.8

**CLEARANCE DELIVERY PHONE:** For CD ctc NorCal Apch at 916-361-6874.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE SAC.

**SACRAMENTO (VH) (H) VORTACW** 115.2 SAC Chan 99 N38°26.62' W121°33.10' 066° 21.3 NM to fld. 3/17E.

VOR unusable:

031°-041° byd 40 NM blo 5,000'

031°-041° byd 45 NM blo 18,000'

157°-169° byd 40 NM blo 4,500'

157°-169° byd 56 NM blo 18,000'

246°-251° byd 40 NM

252°-262° byd 40 NM blo 7,000'

252°-262° byd 65 NM

263°-269° byd 40 NM

353°-013° byd 40 NM blo 5,000'

353°-013° byd 49 NM blo 5,500'

353°-013° byd 58 NM