


WAAS CH 78022 W05B	APP CRS 052°	Rwy Idg 11004 TDZE 744 Apt Elev 744
----------------------------------------	------------------------	----------------------------------------------------------------

RNAV (GPS) RWY 5L

RICKENBACKER INTL (LCK)


RNP APCH - GPS.	MALSR 	MISSED APPROACH: Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.
-----------------	-----------	---------------------------------------------------------------------------------------------

ATIS 132.75	COLUMBUS APP CON 134.0 279.6	RICK TOWER 120.05 348.4	GND CON 125.275 275.8	CLNC DEL 125.275 275.8
-----------------------	----------------------------------------	-----------------------------------	---------------------------------	----------------------------------

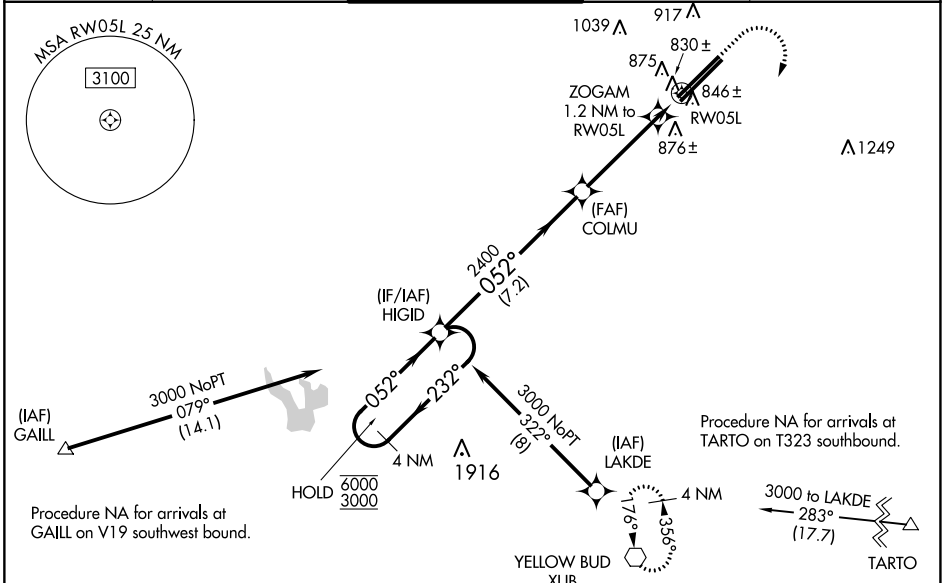


ELEV 744	D	TDZE 744
----------	----------	----------

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).
4 NM Holding Pattern

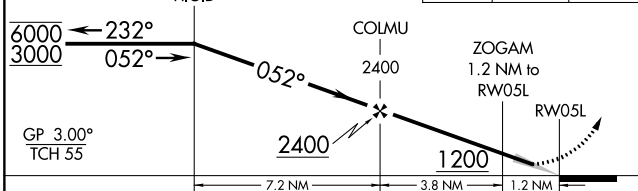

CATEGORY	A	B	C	D
LPV DA		944-1/2	200 (200-1/2)	
RNAV/VNAV DA		1007-1/2	263 (300-1/2)	
RNAV MDA	1100-1/2	356 (400-1/2)	1100-5/8	356 (400-5/8)
CIRCLING	1240-1	496 (500-1)	1280-1 1/2 536 (600-1 1/2)	1400-2 656 (700-2)

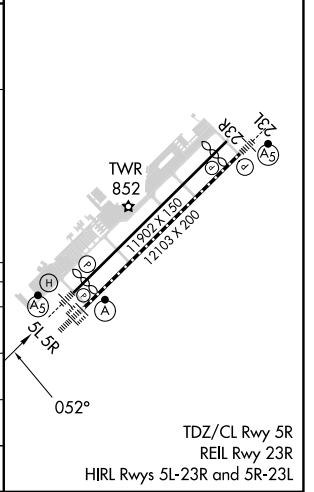

EC-2, 28 NOV 2024 to 26 DEC 2024

EC-2, 28 NOV 2024 to 26 DEC 2024