

MANHATTAN RGNL (MHK)(KMHK) 4 SW UTC-6(-5DT) N39°08.49' W96°40.29'

KANSAS CITY
H-5C, L-101
IAP, AD

1066 B TPA—See Remarks ARFF Index—See Remarks NOTAM FILE MHK

RWY 03-21: H7400X150 (CONC-GRVD) S-120, D-195, 2S-175, 2D-339 PCN 56 R/B/W/T HIRL

RWY 03: MALSR. PAPI(P4L)—GA 3.0° TCH 50'. Trees. Rgt tfc.

RWY 21: REIL. PAPI(P4L)—GA 3.0° TCH 50'. Thld dspld 370'. Trees.

RWY 13-31: H5001X75 (ASPH-CONC) S-30, D-39 PCN 9 R/C/Y/U MIRL 0.3% up NW

RWY 13: VASI(V2L)—GA 3.5° TCH 41'. Pole.

RWY 31: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Tree. Rgt tfc.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 03: TORA-7030 TODA-7030 ASDA-7030 LDA-7030

RWY 13: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

RWY 21: TORA-7400 TODA-7400 ASDA-7400 LDA-7030

RWY 31: TORA-5000 TODA-5000 ASDA-5000 LDA-5000

SERVICE: S4 FUEL 100LL, JET A, MOGAS LGT When ATCT clsd
ACTIVATE MALSR Rwy 03; REIL Rwy 21 & Rwy 31; HIRL Rwy 03-21, MIRL Rwy 13-31—CTAF. PAPI Rwy 03, 21, & 31; VASI Rwy 13; opr consly.

AIRPORT REMARKS: Attended 1200-0400Z. Coyotes and deer on and in/ov all rwys. Migratory birds in/ov arpt Mar-May and Sep-Nov.

Military airfield 7 miles SW resembles this arpt. Class I, ARFF Index B. Index C equipment avbl upon request. After hrs air carrier ops are not authorized in excess of 15 minutes before or after scheduled arrival or departure time without prior coordination to confirm ARFF services are avbl prior to landing or takeoff. Contact MHK ARFF 785-587-4521. 24 hr PPR for unscheduled air carrier ops with more than 30 pax seats, call airport admin 785-587-4597. Rwy 13-31 not avbl for scheduled acr ops with more than 9 psgr seats or unscheduled acr at least 31 psgr seats. Non-standard air traffic control minima applied IFR arrivals with respect to high performance acft ops conducted within confines of R-3602. TPA-1909 (843) light acft, 2509 (1443) turbine acft.

AIRPORT MANAGER: 785-587-4565

WEATHER DATA SOURCES: ASOS 119.075 (785) 537-1035. LAWRS 1200-0400Z.

COMMUNICATIONS: CTAF 118.55

RCO 122.6 (WICHITA RADIO)

Ⓜ **MARSHALL AAF GCA APP/DEP CON** 121.25 (Mon-Thu 1400-0700Z; Fri 1400-2200Z, exc hol other times ct)

Ⓜ **KANSAS CITY CENTER APP/DEP CON** 127.35 (Mon-Fri 0700-1400Z; Fri 2200-1400Z, exc hol)

TOWER 118.55 (1200-0400Z) **GND CON** 121.85

CLEARANCE DELIVERY PHONE: For CD if una ctc on FSS freq, ctc Marshall Apch as 785-239-2118. When Marshall Apch is clsd, ctc Kansas City ARTCC at 913-254-8508.

AIRSPACE: CLASS D svc 1200-0400Z; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE MHK.

(T) (T) **VORW/DME** 110.2 MHK Chan 39 N39°08.73' W96°40.12' at fld. 1044/4E.

DME portion unusable:


232°-002° byd 10 NM blo 3,500'

VOR portion unusable:

262°-284° byd 10 NM blo 3,500'

ILS 111.3 I-MHK Rwy 03. Class IE.

COMM/NAV/WEATHER REMARKS: MULTICOM 122.85 avbl.

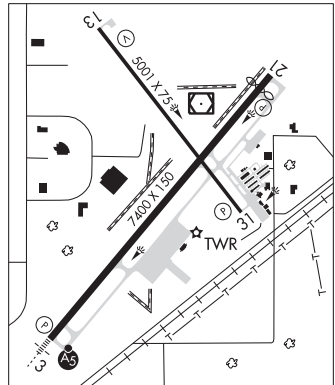

MANKATO (TKO)(KTKO) 1 NW UTC-6(-5DT) N39°48.17' W98°13.27'

WICHITA
L-10H

1859 NOTAM FILE ICT

RWY 17-35: H3540X50 (ASPH) LIRL

RWY 09-27: 2505X100 (TURF)

RWY 09: Trees.

RWY 27: Road.

AIRPORT REMARKS: Attended intermittingly. No line of sight between rwy ends. Rwy 09-27 apch ends marked with painted tires. At the intersection of Rwy 09-27 and Rwy 17-35 a slight change in elevation may cause a rough crossing.

AIRPORT MANAGER: 785-282-0993

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE ICT.

(L) (L) **VORTACW** 109.8 TKO Chan 35 N39°48.38' W98°15.60' 087° 1.8 NM to fld. 1880/10E.

MANKATO N39°48.38' W98°15.60' NOTAM FILE ICT.

WICHITA
L-10H

(L) (L) **VORTACW** 109.8 TKO Chan 35 087° 1.8 NM to Mankato. 1880/10E.