

RAVENSWOOD

JACKSON CO (I18) 6 SW UTC-5(-4DT) N38°55.79' W81°49.17'

758 B NOTAM FILE EKN

RWY 04-22: H4000X75 (ASPH) S-12.5 MIRL 0.5% up NE

RWY 04: REIL. PAPI(P2L)—GA 3.0° TCH 50'. Trees.

RWY 22: REIL. PAPI(P2L)—GA 4.0° TCH 50'. Trees.

SERVICE: S4 FUEL 100LL LGT ACTVT REIL Rwy 04 and 22, PAPI Rwy 04 and 22; MIRL Rwy 04-22 and windssock lgt—CTAF. VGS and descent angles not coincident.

AIRPORT REMARKS: Attended 1300-2100Z. Parachute Jumping. Deer and birds on and in/ov arpt. +482' stack 1/2 mile NW of arpt. 15' trees parallel to Rwy 04, 75' left of centerline. Rwy 04-22 has over 50' drop-off 200' fm thr on each end.

AIRPORT MANAGER: 304-273-8114

WEATHER DATA SOURCES: AWOS-2 121.3 (304) 273-3424.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ HUNTINGTON APP/DEP CON 128.4

CLEARANCE DELIVERY PHONE: For CD ctc Huntington ATCT at 304-453-2490.

RADIO AIDS TO NAVIGATION: NOTAM FILE EKN.

HENDERSON (H) DME 115.9 HNN Chan 106 N38°45.25'

W82°01.57' 043° 14.3 NM to fld. 880.


DME unusable:

185°-290° blo 4,500'

CINCINNATI

L-29B

IAP

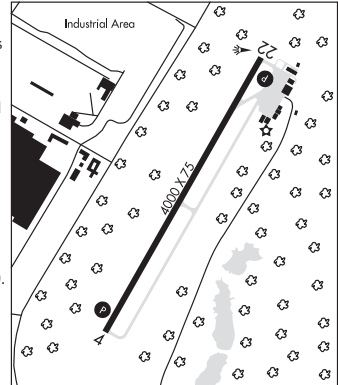

RICHHOOD MUNI (314) 6 W UTC-5(-4DT) N38°15.50' W80°39.08'

2486 NOTAM FILE EKN

RWY 10-28: H3360X60 (ASPH) 2.1% up E

RWY 10: Trees.

RWY 28: Trees.

AIRPORT REMARKS: Unatndd. Arpt CLOSED nghts. Deer and birds on and in/ov arpt. Arpt gate locked. Call amgr for access. Rwy 10-28 no snow removal. Rwy frequently snow covered winter months. Rwy 10-28 soft shoulders. Rwy 10-28 pavement cracks with vegetation.

AIRPORT MANAGER: 304-618-3611

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.

RADIO AIDS TO NAVIGATION: NOTAM FILE BKW.

BECKLEY (H) (DH) VORW/DME 117.7 BKW Chan 124 N37°46.82'

W81°07.41' 044° 36.4 NM to fld. 2517/6W.

DME unusable:


080°-215° byd 15 NM

VOR unusable:

070°-200°

CINCINNATI

L-26I

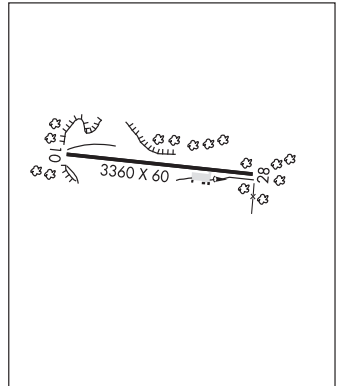

ROBERT NEWLON FLD (See HUNTINGTON on page 400)

SHINNSTON

WADE F MALEY FLD (6WØ) 1 NE UTC-5(-4DT) N39°24.37' W80°16.61'

997 NOTAM FILE EKN

RWY 05-23: 2265X45 (TURF) 0.9% up NE

RWY 05: Trees.

RWY 23: Ground. Rgt tfc.

SERVICE: S2

AIRPORT REMARKS: Unattended. Deer on and in/ov arpt. Rwy 23: 15' drop-off 10' from thld 0B. Rwy 05: 20' drop-off 15' from thld 0B. High terrain all quadrants. Rwy 05-23, 20' pwr poles midpt of rwy, 65' L and R of cntrln. 400' ridge/trees 1,100' from thld Rwy 23 0B. 15' drop-off 45' from centerline full length both sides of rwy. Acft parked 55' W of rwy centerline, approximately 1,000' N of Rwy 05 end. Apch Rwy 23 from northwest, depart Rwy 05 to northwest due to ridge northeast of arpt. Power Plant-2 stacks, 1979 MSL, 1009 AGL, 3 mi SW.

AIRPORT MANAGER: 304-641-8406

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Clarksburg Apch at 304-842-2011, when Apch clsd ctc Cleveland ARTCC at 440-774-0226.

CINCINNATI