

LEXINGTON (9S9) 1 N UTC-8(-7DT) N45°27.25' W119°41.42'

1635 B NOTAM FILE MMV

RWY 08-26: H4156X75 (ASPH) S-12.5 MIRL 1.3% up E

RWY 08: REIL. PAPI(P2L)—GA 3.0° TCH 43' . Fence.

RWY 26: REIL. PAPI(P2L)—GA 3.5° TCH 47' .

SERVICE: FUEL 100LL LGT ACTVT REIL Rwy 08 and 26; PAPI Rwy 08 and 26; MIRL Rwy 08-26—CTAF.

AIRPORT REMARKS: Unattended. Fuel 24 hours credit card svc avbl. Wildlife on and invof arpt. Rwy 08-26 200' gravel east end.

AIRPORT MANAGER: 541-989-9500

WEATHER DATA SOURCES: AWOS-3 134.475 (541) 989-8557.

COMMUNICATIONS: CTAF 122.9

Ⓡ **SEATTLE CENTER APP/DEP CON** 132.6

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE PDT.

PENDLETON (VH) (H) VORTACW 114.7 PDT Chan 94 N45°41.91' W118°56.32' 231° 34.9 NM to fld. 1575/14E.

VOR unusable:

057°-066° byd 40 NM

067°-078° byd 40 NM blo 29,000'

096°-106° byd 40 NM blo 8,300'

096°-106° byd 48 NM blo 18,000'

107°-117° byd 40 NM

118°-128° byd 40 NM blo 12,000'


118°-128° byd 75 NM

129°-207° byd 40 NM

SEATTLE

L-13A

IAP

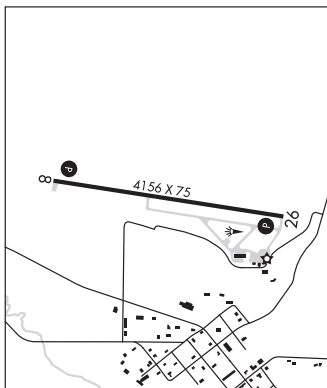

LORD FLAT USFS (See IMNAHA on page 179)

MADRAS MUNI (S33) 3 NW UTC-8(-7DT) N44°40.21' W121°09.31'

2438 B NOTAM FILE MMV

RWY 16-34: H5091X75 (ASPH) S-75, D-120, 2D-180 MIRL

RWY 34: REIL. VASI(V4L)—GA 3.0° TCH 50' .

RWY 04-22: H2701X50 (ASPH) S-16 0.3% up NE

RWY 22: Road.

SERVICE: S4 FUEL 100LL, JET A OX3, 4 LGT ACTVT REIL Rwy 34; VASI Rwy 34; MIRL Rwy 16-34—CTAF.

AIRPORT REMARKS: Attended Nov-Apr 1600-0100Z‡, May-Oct 1600-0200Z‡. Deer, coyote and cougar on and invof arpt.

Rwy 04-22 marked with white reflectors. Cold temperature airport. Altitude correction required at or below -20C. See

Special Notices — Intensive Flight Training Advisory.

AIRPORT MANAGER: 541-777-4935

WEATHER DATA SOURCES: AWOS-3PT 132.425 (541) 475-0494.

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ **SEATTLE CENTER APP/DEP CON** 126.15

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

SEATTLE

H-1B, L-13A

IAP

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE RDM.

DESCHUTES (VH) (H) VORTACW 117.6 DSD Chan 123 N44°15.17' W121°18.21' 356° 25.8 NM to fld.
4103/18E.

VOR unusable:

013°-023° byd 40 NM
034°-039° byd 40 NM
108°-119° byd 40 NM
125°-135° byd 40 NM
150°-163° byd 40 NM
188°-201° byd 40 NM blo 10,500'
188°-201° byd 69 NM
202°-219° byd 40 NM
220°-240° byd 30 NM
241°-252° byd 40 NM blo 13,000'
241°-252° byd 47 NM
253°-257° byd 40 NM
258°-268° byd 40 NM blo 10,000'
258°-268° byd 48 NM
280°-286° byd 40 NM
289°-305° byd 40 NM blo 12,500'
289°-305° byd 48 NM
326°-338° byd 40 NM

TACAN AZIMUTH unusable:

220°-240° byd 30 NM

DME unusable:

220°-240° byd 30 NM

MAHLON SWEET FLD (See EUGENE on page 173)**MALIN** (4S7) 1 SE UTC-8(-7DT) N42°00.07' W121°23.78'

KLAMATH FALLS

4053 NOTAM FILE MMV

RWY 14-32: H2800X30 (ASPH)**RWY 32:** Road.**SERVICE:** FUEL 100LL

AIRPORT REMARKS: Unattended. Rwy 14-32 numbers smaller than standard, no centerline. Rwy 32 thld marked with white chevrons. Rwy 32 has NSTD displaced threshold markings. Twy not marked with centerline. Parking apron not equipped with tie downs. Remote ctld acft in vcnty.

AIRPORT MANAGER: 541-723-3021**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.**MANZANITA****NEHALEM BAY STATE** (3S7) 2 S UTC-8(-7DT) N45°41.89' W123°55.78'

SEATTLE

30 NOTAM FILE MMV

RWY 15-33: H2350X50 (ASPH)**RWY 15:** Hill.**AIRPORT REMARKS:** Unattended. Wildlife invov rwy. Unpaved twy and ramp. Sfc conds not rptd.**AIRPORT MANAGER:** 503-378-4880**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.