

RAEFORD**P K AIRPARK** (5W4) 3 NE UTC-5(-4DT) N35°01.19' W79°11.46'

304 B NOTAM FILE RDU

RWY 04-22: H3402X60 (ASPH) S-30 MIRL 0.4% up NE**RWY 04:** Trees.**RWY 22:** Trees. Rgt tfc.**SERVICE:** FUEL 100LL, JET A+**AIRPORT REMARKS:** Attended 1330Z†-dusk. Parachute Jumping. After hrs svc 910-578-4401. Low flying mil acft in area, arpt located within a MOA. Caution, do not overfly airport due to PJA. Frequent parachute activity to target 300' SE of terminal apron. Fly 1 mile down wind leg to prevent conflicts with parachute jumping activity (Drop Zone SE from rwy).**AIRPORT MANAGER:** (910) 904-0000**COMMUNICATIONS:** CTAF/UNICOM 123.0

® FAYETTEVILLE APP/DEP CON 127.8

CLEARANCE DELIVERY PHONE: For CD ctc Washington ARTCC at 703-771-3587.**RADIO AIDS TO NAVIGATION:** NOTAM FILE FAY.**FAYETTEVILLE (L) (L) VORW/DME** 114.85 FAY Chan 95(Y)

N34°59.13' W78°52.50' 282° 15.7 NM to fld. 187/4W.

VOR unusable:

058°-068° blo 4,000'

090°-100°

DME unusable:

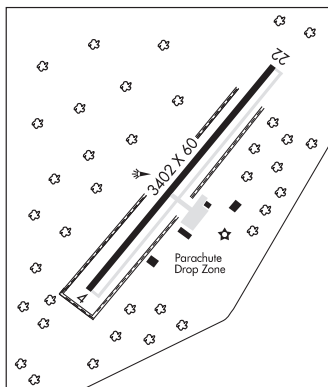
090°-100°

COMM/NAV/WEATHER REMARKS: Monitor frequency 123.5 for parachute jumping activity. Acft in vicinity monitor 123.5.

CHARLOTTE

L-35A, 36F

IAP

**RALEIGH****TRIPLE W** (5W5) 11 SW UTC-5(-4DT) N35°37.22' W78°42.02'

244 B NOTAM FILE RDU

RWY 16-34: H3004X40 (ASPH) LIRL(NSTD) 0.3% up N**RWY 16:** Trees.**RWY 34:** Trees.**SERVICE:** LGT Dusk—0500Z†. Actvt LIRL—CTAF. No CTAF prior to dusk. Rwy 16-34 NSTD LIRL. Rwy 16-34 lgts 15' from edge of rwy. No thld lgts. Twy not lgtd.**AIRPORT REMARKS:** Attended irregularly. Deer on and invof arpt. Numerous unlighted obstructions invof arpt. Night or tsnt tfc ldrs not recommended. Rwy 16-34 PAEW parallel twy. All acft over 6500 lbs. prohibited. Tower (500 AGL/826' MSL) approximately 1.75 NM NW of arpt. Be alert for rising terrain all quadrants. Rwy 16-34 has 4' dropoff 20' from pavement edge all sides. 4 ft dropoff twy edge both sides—south end. Be alert 1000' of twy North end Rwy 16 unusbl due to erosion under pavement. CAUTION: vehicles on or invof Rwy 16-34. Rwy 16-34 heavy vegetation in cracks. Rwy 16-34 markings nonexistent.**AIRPORT MANAGER:** (919) 971-3718**COMMUNICATIONS:** CTAF/UNICOM 122.7**CLEARANCE DELIVERY PHONE:** For CD ctc Raleigh Apch at 919-380-3144.**RADIO AIDS TO NAVIGATION:** NOTAM FILE RDU.**RALEIGH/DURHAM (H) (H) VORTACW** 117.2 RDU Chan 119 N35°52.35' W78°47.00' 174° 15.6 NM to fld. 429/9W.

CHARLOTTE

L-35B, 36F

RALEIGH EAST (See KNIGHTDALE on page 320)**RALEIGH EXEC JETPORT AT SANFORD—LEE CO** (See SANFORD on page 346)**RALEIGH RGNL AT PERSON CO** (See ROXBORO on page 344)**RALEIGH—DURHAM INTL** (See RALEIGH/DURHAM on page 341)