

TELLURIDE RGNL (TEX)(KTEX) 5 W UTC-7(-6DT) N37°57.23' W107°54.53'
 9070 B TPA-10484(1414) ARFF Index-See Remarks NOTAM FILE TEX
RWY 09-27: H7111X100 (ASPH-GRVD) S-45, D-89 PCN 35 F/D/X/T

DENVER
 H-3E, L-9E
 IAP, AD

HIRL 0.4% up E
RWY 09: REIL. PAPI(P4L)-GA 3.55° TCH 46'. Thld dsplcd 200'. Rgt tfc.
RWY 27: REIL. PAPI(P4L)-GA 4.0° TCH 40'. Thld dsplcd 200'.

RUNWAY DECLARED DISTANCE INFORMATION

RWY 09: TORA-7111 TODA-7111 ASDA-7111 LDA-6911
RWY 27: TORA-7111 TODA-7111 ASDA-7111 LDA-6911


ARRESTING GEAR/SYSTEM

RWY 09: EMAS
RWY 27: EMAS

SERVICE: FUEL 100LL, JET A OX 1, 2, 3, 4 LGT Rwy 27 PAPI lgts unusable byd 2.5 NM due to terrain. ACTIVATE HIRL Rwy 09-27, PAPI Rwy 09, and Rwy 27, REIL Rwy 09 and Rwy 27-CTAF. Arpt lighting system emerg use only 0400-1300Z‡.

NOISE: Noise abatement procedures in effect. For more information ctc TEX customer svc 970-728-8600.

AIRPORT REMARKS: Attended Apr-Oct 1400-0400Z‡, Nov-Mar 1400-0100Z‡. Arpt CLOSED 0400-1300Z‡. Rising terrain all quadrants. Arpt on 1000' mesa, strong vertical turbulence in area of mesa edge. Rwy 09-27 recommended tkf Rwy 27, land Rwy 09 and avoid populated areas. Rwy 09-27 grade -.08 on rwy ends, -1.3 to approximately midpoint then +.75. Glider, hang glider and helicopter ops on and in/ov arpt. ARFF Index rstd to FAR 139 design groups Al-CIII. Cold temperature airport. Altitude correction required at or below -18C. Air carrier ops during unattended hrs must notify TEX customer svc at 970-728-8603 24 hrs in advance for provision of adequate ARFF personnel. Ldg fee.

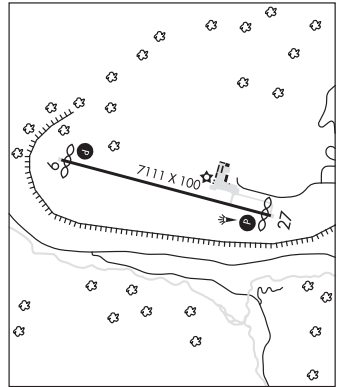

AIRPORT MANAGER: (970) 728-8601

WEATHER DATA SOURCES: AWOS-3 118.325 (970) 728-1534.

COMMUNICATIONS: CTAF/UNICOM 123.0

RCO 122.2 (DENVER RADIO)

® DENVER CENTER APP/DEP CON 125.35

CLEARANCE DELIVERY PHONE: For CD contact Denver ARTCC at 303-651-4814. If una to ctc Denver ARTCC, ctc Denver radio.

RADIO AIDS TO NAVIGATION: NOTAM FILE DEN.

CONES (VL) (L) VORW/DME 116.95 ETL Chan 116(Y) N38°02.42' W108°15.51' 095° 17.4 NM to fld. 8460/12E. VOR/DME unmonitored.

- VOR unusable:
 042°-096° byd 40 NM
 097°-141° byd 25 NM
 142°-147° byd 40 NM
 148°-178° byd 15 NM
 179°-185° byd 40 NM
 205°-226° byd 40 NM
 280°-040° byd 40 NM
 349°-021° byd 35 NM blo 16,000'
 DME unusable:
 077°-088° byd 30 NM
 097°-141° byd 25 NM
 148°-178° byd 15 NM
 207°-220° byd 34 NM blo 14,000'
 349°-021° byd 35 NM blo 16,000'

LDA/DME 109.3 I-TEX Chan 30 Rwy 09. LOC unusable byd 20° either side of course centerline; within 0.9 NM, 1.0 DME, from thld. DME unusable 20° left and right of course.

THURMAN N39°41.90' W103°12.90' NOTAM FILE DEN.

WICHITA
 H-5A, L-10G

(VL) (H) VORTAC 112.9 TXC Chan 76 208° 32.9 NM to Limon Muni. 4890/12E.

- VOR unusable:
 195°-224° byd 40 NM
 225°-235° byd 40 NM blo 18,000'
 236°-245° byd 40 NM
 246°-256° byd 40 NM blo 8,500'
 246°-256° byd 65 NM
 257°-270° byd 40 NM blo 18,000'