

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAR.

(VL) (L) VOR/DME 117.6 LAR Chan 123 N41°20.27' W105°43.26' 113° 2.6 NM to fld. 7299/14E.

VOR unusable:

- 015°-049° byd 40 NM
- 050°-062° byd 40 NM blo 12,000'
- 050°-062° byd 53 NM blo 18,000'
- 063°-080° byd 40 NM
- 081°-091° byd 22 NM blo 18,000'
- 092°-119° byd 40 NM
- 120°-130° byd 40 NM blo 11,000'
- 120°-130° byd 51 NM
- 170°-180° byd 40 NM blo 15,600'
- 170°-180° byd 55 NM
- 181°-216° byd 40 NM
- 217°-227° byd 40 NM blo 13,300'
- 217°-227° byd 49 NM
- 228°-232° byd 40 NM
- 233°-243° byd 40 NM blo 23,000'
- 244°-267° byd 40 NM
- 268°-278° byd 40 NM blo 12,200'
- 268°-278° byd 49 NM
- 279°-285° byd 40 NM

**LUSK MUNI** (LSK)(KLSK) 3 E UTC-7(-6DT) N42°45.23' W104°24.27'

CHEYENNE  
H-5A, L-12F

4967 B NOTAM FILE CPR

**RWY 10-28:** H5058X75 (ASPH) S-12.5 MIRL

**RWY 10:** PAPI(P2L)—GA 3.0° TCH 40'. Pole.

**RWY 28:** REIL. PAPI(P2L)—GA 3.0° TCH 40'.

**SERVICE:** FUEL 100LL LGT ACTVT REIL Rwy 28; PAPI Rwy 10 and Rwy 28; MIRL Rwy 10-28—122.8.

**AIRPORT REMARKS:** Unattended. Fuel avbl via credit card reader.

**AIRPORT MANAGER:** 307-334-3622

**WEATHER DATA SOURCES:** AWOS-3PT 118.350 (307) 334-4028.

**COMMUNICATIONS:** CTAF/UNICOM 122.8

RCO 122.3 (CASPER RADIO)


**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Denver ARTCC at 303-651-4257.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE DGW.

**HIPSHER (VL) (DH) VOR/DME** 115.75 IIP Chan 104(Y)  
N42°40.57' W105°13.57' 070° 36.6 NM to fld.  
4906/12E.

VOR unusable:

- 165°-309° byd 40 NM
- 310°-320° byd 40 NM blo 8,300'
- 310°-320° byd 53 NM
- 321°-334° byd 40 NM
- 335°-345° byd 40 NM blo 7,500'
- 335°-345° byd 56 NM
- 346°-040° byd 40 NM

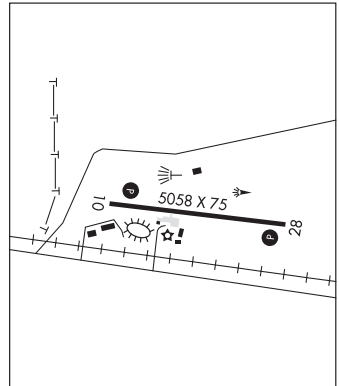

**MEDICINE BOW** (8ØV) 2 SE UTC-7(-6DT) N41°53.04' W106°10.97'

CHEYENNE

6658 NOTAM FILE CPR

**RWY 10-28:** 3170X80 (TURF-DIRT)

**RWY 06-24:** 2680X50 (TURF-DIRT)

**AIRPORT REMARKS:** Unattended. Wildlife invof all rwys. Rwy 06-24 is no longer maintained. Rwy 06-24, 9 to 12 inch berms both sides of rwy. Rwy 10-28 graded. Gopher holes on rwy sfcs, rwys very soft when wet. Rwy 10-28 1' ditch south of rwy. Rwy 06-24 rough and uneven full length, numerous gopher and badger holes. Rwy 10-28 marked with yellow 3' x 2' cones. Thld markings skewed at angle to Rwy 06-24.

**AIRPORT MANAGER:** 307-703-0418

**COMMUNICATIONS:** CTAF 122.9

**CLEARANCE DELIVERY PHONE:** For CD ctc Denver ARTCC at 303-651-4257.