



ILS or LOC RWY 36C
CHARLOTTE/DOUGLAS INTL (CLT)

MISSED APPROACH: Climb to 3000 on CLT
VOR/DME R-001 to TOMME/CLT 15.4 DME
and hold.



LOCALIZER 111.7

I-DQG 

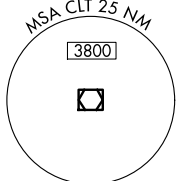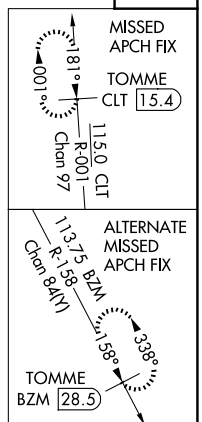

3000 ↑ CLT R-001	TOMME CLT 15.4	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 72).				SOLMN CLT 22.2 RADAR
GLASI CLT 4.8 RADAR	NIVSE CLT 6.4 RADAR	MARJO CLT 9.6 RADAR	DENNE INT CLT 12.7 RADAR	HUNEX CLT 15.9 RADAR	KRISL CLT 19 RADAR	
						GS 3.00° TCH 57
CATEGORY		B		C		D
S-ILS 36C		907/18		200 (200-½)		
S-LOC 36C		1120/24		413 (400-½)		
C CIRCLING		1380-1 632 (700-1)		1500-2¼ 752 (800-2¼)		1500-2½ 752 (800-2½)