

▼

NA

Rwy 31 helicopter visibility reduction below 1 SM NA. DME/DME RNP-0.3 NA. Procedure NA at night. Use Benton Harbor altimeter setting; when not received, use South Bend Intl altimeter setting and increase all MDA 40 feet. Increase LP and LNAV Cts C/D visibility 1/8 SM and Circling Cts B/C 1/4 SM.

MISSED APPROACH:



Climb to 3000 direct STNGG and hold.

SOUTH BEND APP CON ★

118.55 257.8

UNICOM

122.7 (CTAF) 0

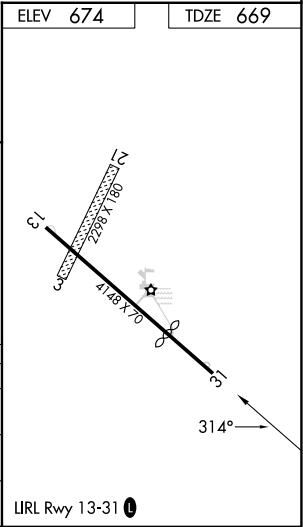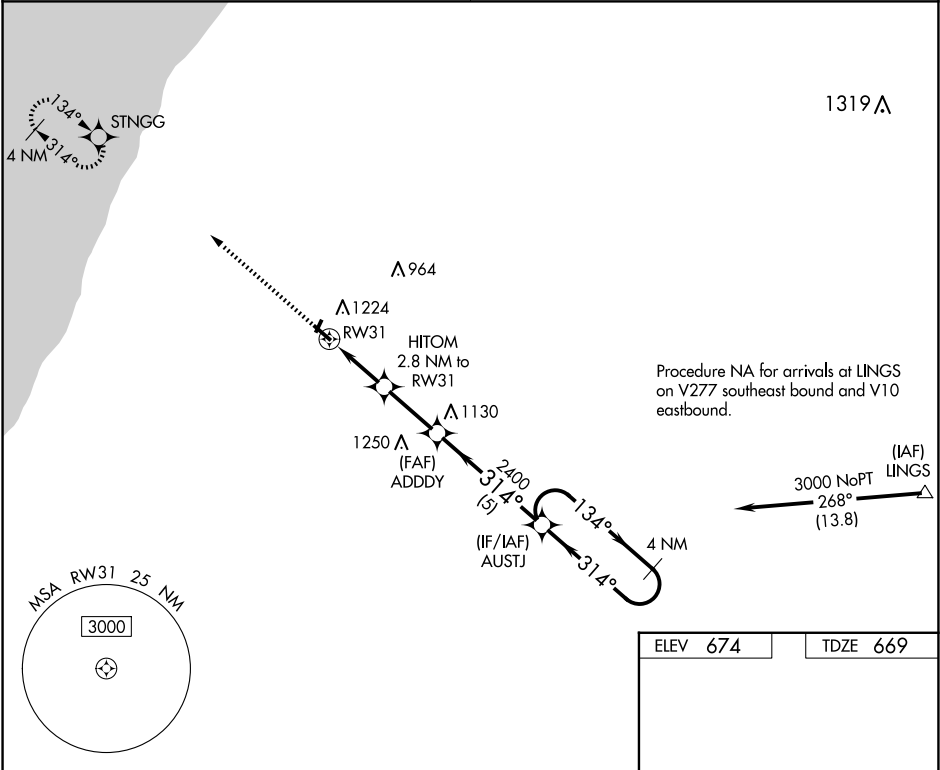

3000		STNGG		
RWY 31		HITOM 2.8 NM to RWY 31	AUSTJ 4 NM Holding Pattern	
1600		2400	3000	
2.8 NM		2.5 NM	5 NM	
CATEGORY	A	B	C	D
LP MDA	1100-1	431 (500-1)	1100-1¼	431 (500-1¼)
LNAV MDA	1160-1	491 (500-1)	1160-1⅜	491 (500-1⅜)
CIRCLING	1620-1¼	946 (1000-1¼)	1620-2¾ 946 (1000-2¾)	1620-3 946 (1000-3)