

**PEMBINA MUNI** (PMB)(KPMB) 1 S UTC-6(-5DT) N48°56.55' W97°14.44'

TWIN CITIES

796 B AOE NOTAM FILE GFK

L-14G

RWY 15-33: H3798X75 (ASPH) S-12.5 MIRL

IAP

RWY 15: PAPI(P2L)—GA 3.0° TCH 26'.

RWY 33: PAPI(P2L)—GA 3.0° TCH 26'.

SERVICE: S4 FUEL 100LL LGT ACTIVATE MIRL Rwy 15-33; PAPI Rwy 15 &amp; Rwy 33—CTAF.

**AIRPORT REMARKS:** Attended continuously. For svcs ctc amgr. Birds & deer on & invof arpt. Fuel: 100LL: fuel svc H24 prvdd by amgr fuel truck. Cfm winter conds & sn removal bfr use, call 701-331-4458 or 701-825-6615. Rwy 15-33 twy to apron marked with reflectors. Rwy 15-33 500' stopway north end. Flight Notification Service (ADCUS) avbl.

**AIRPORT MANAGER:** 701-331-4458**COMMUNICATIONS:** CTAF/UNICOM 122.8® **MINNEAPOLIS CENTER APP/DEP CON** 132.15**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.**RADIO AIDS TO NAVIGATION:** NOTAM FILE PNM.**HUMBOLDT (H) TACAN** Chan 71 HML (112.4) N48°52.15' W97°07.07' 303° 6.6 NM to fld. 797/9E.

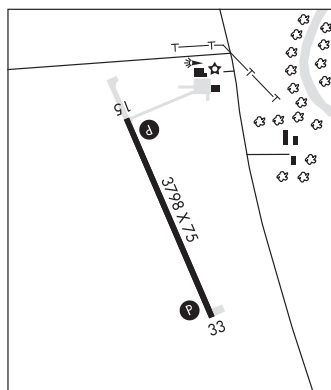
TACAN AZIMUTH unusable:

075°-085° blo 10,000'

086°-254° byd 35 NM blo 3,000'

255°-270°

271°-074° byd 35 NM blo 3,000'

**PLAZA****TRULSON FLD** (Y99) 1 NE UTC-6(-5DT) N48°01.83' W101°57.19'

BILLINGS

2105 NOTAM FILE GFK

RWY 08-26: 3200X60 (TURF)

RWY 08: Road.

RWY 26: Tree. Rgt tfc.

**AIRPORT REMARKS:** Unattended. All traffic operations are conducted to north of Rwy 08-26, all turns to rgt when Indg/departing Rwy 26; and all turns to left when Indg/departing Rwy 08. Landfill 2500 ft fm Rwy 08 thr on cntrln-birds poss. Rwy 08-26 clumps, rolls, & rutting entr len. 15 ft trees lctd 50 ft S of rwy cntrln, starting at Rwy 26 thld. Rwy 08-26 cultivated fld 40 ft L & R of rwy cntrln entr len. Dirt mounds prsnt. Snow removal ireg; confirm winter cond with amgr; call 701-898-3387 or 701-453-3387; prior request only. Snow removal ltd to emerg.

**AIRPORT MANAGER:** 701-898-3387**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.**RED RIVER** N47°57.42' W97°24.36' NOTAM FILE GFK.

TWIN CITIES

(H) TACAN 116.4 RDR Chan 111 904/3E.

H-2H, L-14G

No NOTAM MP: 1200-1500Z† Mon, Wed, Fri

TACAN AZIMUTH unusable:

103°-105° byd 30 NM

220°-263° blo 2,600'

220°-263° byd 15NM

286°-288° byd 30 NM

DME unusable:

209°-219° byd 30 NM

220°-263° blo 2,600'

220°-263° byd 15NM

**RICHARDTON** (4E8) 2 NW UTC-6(-5DT) N46°53.75' W102°21.40'

BILLINGS

2498 NOTAM FILE GFK

RWY 11-29: 3822X110 (TURF)

**AIRPORT REMARKS:** Unattended. 24 hr PPR call 701-290-4335. Cattle grazing on rwy during Sept-Oct. Check NOTAMS prior to use. For winter cond call 701-290-4335 as no snow removal is avbl; confirm prior to use. Rwy 11-29 rwy sfc clumpy & extremely rough. Dirt mounds present. Cultivated fld at rwy ends and along sides. Rwy 11-29 ends/edges marked with 2 ft metal dalgt mkr. Arpt access road unimproved trail, impassable when wet. No tie-down ropes avbl.

**AIRPORT MANAGER:** 701-974-3315**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Minneapolis ARTCC at 651-463-5588.