

WAAS CH 78001 W32A	APP CRS 317°	Rwy Idg 7120 TDZE 102 Apt Elev 107
--	------------------------	---


RNAV (GPS) RWY 32
MC ALLEN INTL (MFE)

T For uncompensated Baro-VNAV systems, LNAV/VNAV NA below 1°C (34°F) or above 54°C (130°F). Circling NA northeast of Rwy 14-32. DME/DME RNP-0.3 NA.


A When local altimeter setting not received, use Wesloco altimeter setting: increase all DA 39 feet and LNAV/VNAV all Cat visibility $\frac{1}{4}$ mile; increase all MDA 40 feet and LNAV Cat C/D visibility $\frac{1}{8}$ mile. Baro-VNAV and VDP NA when using Wesloco altimeter setting.

MISSED APPROACH: Climb to 800 then climbing right turn to 2000 direct SANCA and hold.

ATIS 128.5	VALLEY APP CON 126.55 377.2	MC ALLEN TOWER* 118.5 (CTAF) 0 256.9	GND CON 121.8	UNICOM 122.95
----------------------	---------------------------------------	--	-------------------------	-------------------------

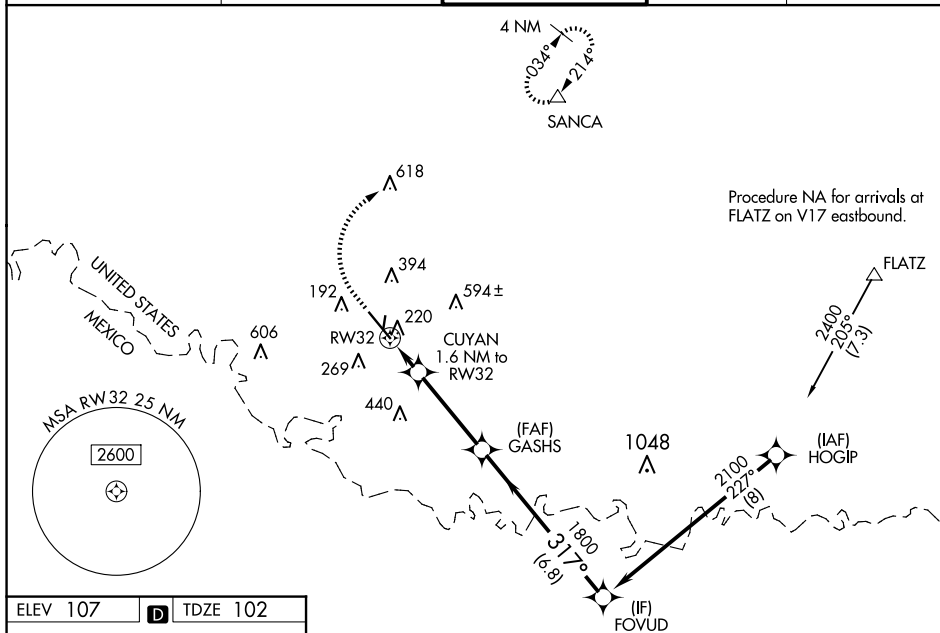

ELEV 107	D	TDZE 102
----------	----------	----------

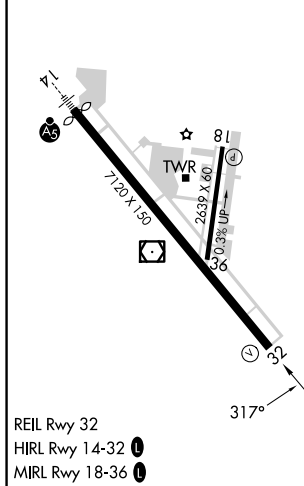

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00°/TCH 53).

FOVUD

*LNAV only

CUYAN
1.6 NM to RW32

GASHS
1800

RW32

*1 NM to RW32

660

2100

317°

1800

GP 3.00°
TCH 50

CATEGORY	A	B	C	D
LPV DA		302-¾	200 (200-¾)	
LNAV/ VNAV		391-⅞	289 (300-⅞)	
LNAV MDA		480-1	378 (400-1)	
C CIRCLING	580-1	473 (500-1)	580-1½ 473 (500-1½)	800-2¼ 693 (700-2¼)