

GRANT MUNI (GGF)(KGGF) 2 N UTC-7 (-6DT) N40°52.24' W101°44.03'

3425 B NOTAM FILE OLU

RWY 15-33: H4797X60 (CONC) S-30, D-30 MIRL

SERVICE: FUEL 100LL LGT ACTVT MIRL Rwy 15-33—CTAF.

AIRPORT REMARKS: Attended Mon-Fri 1500-0000Z†. Self svc H24 via credit card. FBO on arpt Mon-Fri 1500-0000Z†, flt instrn avbl. Ctc 308-491-9001.

AIRPORT MANAGER: (308) 352-2100

WEATHER DATA SOURCES: AWOS-3PT 118.025 (308) 352-4689.

COMMUNICATIONS: CTAF/UNICOM 122.8

® DENVER CENTER APP/DEP CON 132.7

CLEARANCE DELIVERY PHONE: For CD ctc Denver ARTCC at 303-651-4257.

RADIO AIDS TO NAVIGATION: NOTAM FILE OGA.

SEARLE (T) (T) VORW/DME 110.2 SAE Chan 39 N41°07.15' W101°46.56' 166° 15.0 NM to fld. 3256/7E.

DME portion unusable:

274°-034° byd 15 NM


NORTH PLATTE (L) (L) VORW/DME 117.4 LBF Chan 121 N41°02.92'

W100°44.83' 246° 46.1 NM to fld. 3069/11E. NOTAM FILE LBF.

NDB (MHW) 359 GGF N40°52.26' W101°43.83' at fld.

3412/9E. NOTAM FILE OLU.

COMM/NAV/WEATHER REMARKS: SAWRS avbl for Part 135 ops; Call 308-352-2223 at least 24 hrs in advance.

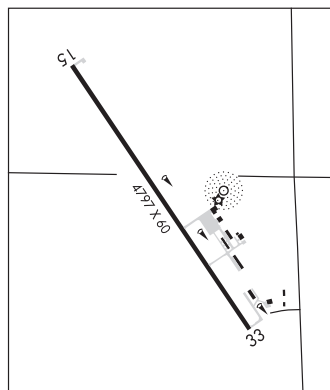**HARLAN CO LAKE SPB** (See ALMA on page 290)**HARTINGTON MUNI/BUD BECKER FLD** (ØB4) 2 SE UTC-6(-5DT) N42°36.19' W97°15.21'

1388 B NOTAM FILE OLU

RWY 13-31: H3950X60 (CONC) MIRL 0.3% up SE

RWY 13: PAPI(P2L)—GA 3.5° TCH 46'.

RWY 31: PAPI(P2L)—GA 3.25° TCH 40'. Thld dsplcd 400'.

RWY 03-21: 2150X125 (TURF) 0.6% up SW

SERVICE: S4 FUEL 100LL LGT Actvt PAPI Rwy 13 & 31, MIRL Rwy 13-31—CTAF.

AIRPORT REMARKS: Attended continuously. For fuel call 402-254-7316 or 402-841-0659. Rwy 03-21 not plowed during winter months.

AIRPORT MANAGER: 402-841-0659

COMMUNICATIONS: CTAF 122.9

® MINNEAPOLIS CENTER APP/DEP CON 125.025


CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE YKN.

YANKTON (L) DME 111.4 YKN Chan 51 N42°55.10' W97°23.10' 163° 19.8 NM to fld. 1301.

DME unusable:

249°-264° byd 24 NM blo 2,800'

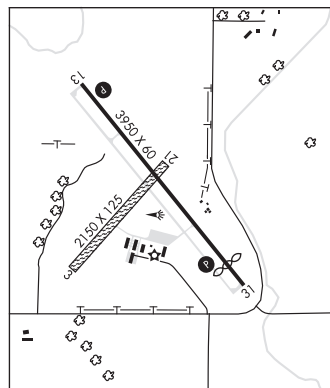

OMAHA

L-12H

IAP