

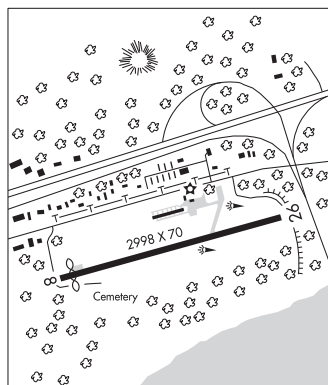
CHESAPEAKE/HUNTINGTON WVA**LAWRENCE CO AIRPARK** (HTW)(KHTW) 2 W UTC-5(-4DT) N38°25.15' W82°29.69'

CINCINNATI

567 B TPA-1607(1040) NOTAM FILE DAY

RWY 08-26: H2998X70 (ASPH) MIRL 0.3% up E**RWY 08:** Thld dsplcd 172'. Trees.**SERVICE:** S2 **FUEL** 100LL **LGT** ACTIVATE MIRL **Rwy 08-26**—CTAF.**AIRPORT REMARKS:** Unattended. Fuel: 100LL avbl H24 self svc via credit card.**AIRPORT MANAGER:** 740-532-3309**COMMUNICATIONS:** CTAF/UNICOM 122.7**CLEARANCE DELIVERY PHONE:** For CD ctc Huntington ATCT at

304-453-2490.

**CLARKSBURG****NORTH CENTRAL WEST VIRGINIA** (CKB)(KCKB) P (ARNG) 1 NE UTC-5(-4DT) N39°17.86'

CINCINNATI

W80°13.65'

1224 B Class I, ARFF Index B NOTAM FILE CKB

RWY 03-21: H7800X150 (ASPH-GRVD) S-80, D-125, 2S-158,

2D-180, 2D/2D2-180 PCN 46 F/B/X/U HIRL 0.5% up NE

RWY 03: REIL. PAPI(P4L)—GA 3.44° TCH 50'. RVR-R Thld dsplcd 670'. Trees.**RWY 21:** MALSR. PAPI(P4L)—GA 3.0° TCH 60'. RVR-T Trees.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 03:** TORA-7800 TODA-7800 ASDA-7800 LDA-7130**RWY 21:** TORA-7800 TODA-7800 ASDA-7130 LDA-7130**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** Actvt MALSR **Rwy 21;** REIL **Rwy**03; PAPI **Rwy 03** and 21; and HIRL **Rwy 03-21** —CTAF.**MILITARY—FUEL** A, A+ (1000-0400Z); After hr C304-848-6700, fee

\$75.00/occurrence. Two hr PN rqr prior to 2300Z;

C304-842-3400.) (NC-100LL - Not avbl 0400-1000Z.)

AIRPORT REMARKS: Attended 1200-0400Z. After hrs for emergs call

304-623-6559. Deer and birds on and invof arpt. Fuel not avbl

during hrs 0400-1000Z. Ctlng obstn slope at dsplcd location **Rwy**

03 is 29:1. PPR 24 hours for unsked ACR ops with more than 30 psgr

seats call amgr 304-842-3400 or 304-848-6700. **Twy A** south of**Twy C**, main terminal apron, and helipad not visible from twr. **Twy H**,E of **Twy H1** clsd to tran aircraft. 24 PPR for parking on ARNG ramp DSN 661-3800, C304-201-3800. Ldg fee for all

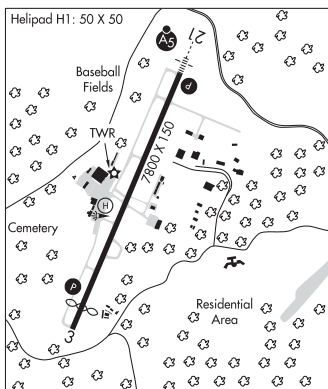
acft over 6500 lbs.

AIRPORT MANAGER: 304-842-3400**WEATHER DATA SOURCES:** ASOS (304) 842-9240. LAWRS.**COMMUNICATIONS:** CTAF 126.7 ATIS 127.825 UNICOM 123.0

® CLARKSBURG APP/DEP CON 121.15 (1200-0400Z)

® CLEVELAND CENTER APP/DEP CON 126.95 (0400-1200Z) or ctc Cleveland ARTCC at 440-774-0226

CLARKSBURG TOWER 126.7 (1200-0400Z) GND CON 121.9 ARNG OPS 123.425

CLEARANCE DELIVERY PHONE: For CD ctc Clarksburg Apch at 304-842-2011, when Apch clsd ctc Cleveland ARTCC at 440-774-0226.**AIRSPACE:** CLASS D svc 1200-0400Z; other times CLASS G.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE CKB.

CLARKSBURG (L) (L) VOR/DME 112.6 CKB Chan 73 N39°15.19' W80°16.07' 039° 3.3 NM to fld. 1427/4W.

VOR unusable:

041°-051° byd 6 NM

056°-081°

116°-137°

ILS 109.3 I-CKB Rwy 21. Class IB. Unmonitored when ATCT clsd. Glideslope unusable byd 5° left of course.

Autopilot cpd apch NA blw 2,000' MSL. LOC front unusable byd 15° left and r of course.

HELIPAD H1: H50X50 (CONC)

HELIPORT REMARKS: Helipad H1 located on FBO apron. Heli, H-1 sfc cond fair, pavement cracking.

COALTON N38°52.35' W79°55.63'

RCO 122.2 (ELKINS RADIO)

CINCINNATI

L-29C

EASTERN WV RGNL/SHEPHERD FLD (See MARTINSBURG on page 396)

ELKINS/RANDOLPH CO (JENNINGS RANDOLPH FLD) (EKN)(KEKN) 2 S UTC-5(-4DT) N38°53.37'

CINCINNATI

W79°51.43'

L-29C

1987 B TPA-3000(1013) NOTAM FILE EKN

IAP

RWY 14-32: H4544X140 (ASPH) S-10 1.0% up NW

RWY 14: Tree.

RWY 32: Thld dsplcd 1390'. Trees.

RWY 05-23: H4501X75 (ASPH) S-28, D-35, 2D-56 MIRL 0.6% up SW

RWY 05: Thld dsplcd 154'. Trees.

RWY 23: REIL. PAPI(P2L)-GA 5.0° TCH 45'. Antenna.

SERVICE: FUEL 100LL, JET A LGT Actvt MIRL Rwy 05-23 & REIL Rwy 23-122.9. Rwy 23 omni-directional REIL. PAPI Rwy 23 non-std 5 deg glide angle.

AIRPORT REMARKS: Attended 1330-2200Z. Rwy 14-32 CLOSED dusk-dawn. Deer on and invof arpt. Uncontrolled vehicles Rwy 32 crossing thr. For aftr hrs serv call amgr during bus hrs. All fueling 24 hr self service. Rwy 05-23 & Rwy 14-32 2-12 inch deep drainage structures on paved shoulders. Rwy 14-32 mkgs faded. Rwy 23, 68 ft athletic fld lgts, 550 ft south of rwy centerline. Cold temperature airport. Altitude correction required at or below -20C.

AIRPORT MANAGER: 304-636-2726

WEATHER DATA SOURCES: ASOS 119.275 (304) 636-5603.

COMMUNICATIONS: CTAF 123.6

® CLARKSBURG APP/DEP CON 121.15 (1200-0400Z)

® WASHINGTON CENTER APP/DEP CON 128.6 (0400-1200Z)

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Washington ARTCC at 703-771-3587.

AIRSPACE: CLASS E svc 1200-0400Z; other times CLASS G.

RADIO AIDS TO NAVIGATION: NOTAM FILE EKN.

(L) (L) VORTACW 114.2 EKN Chan 89 N38°54.87' W80°05.96' 104° 11.4 NM to fld. 2160/7W.

TACAN AZIMUTH unusable:

081°-148° byd 32 NM blo 9,000'

149°-193°

273°-039° byd 12 NM blo 6,000'

DME unusable:

081°-148° byd 32 NM blo 9,000'

149°-193°

273°-039° byd 12 NM blo 6,000'

RANDOLPH COUNTY NDB (HW) 284 RQY N38°53.64' W79°51.56' at fld. 1938/7W.

NDB unusable:

018°-084° byd 10 NM

085°-017° byd 15 NM

LDA/DME 109.9 I-OUW Chan 36 Rwy 00X. LDA is circling apch only. LOC unusable byd 6.0 NM blw 4,500'. DME portion unusable byd 6.0 NM blw 4,500'.

