


ILS RWY 27R (CAT II & III)
CHICAGO O'HARE INTL (ORD)


MISSED APPROACH: Climb to 1100 then climbing right turn to 4000 direct OBK VOR/DME and hold, continue climb-in-hold to 4000.


ALSF-2

D-ATIS 135.4 282.225	CHICAGO APP CON 119.0 292.125	O'HARE TOWER 128.15 348.0	GND CON (TWR NORTH) 124.125 (TWR SOUTH) 118.05 (ALL TWRS) 226.675	(TWR CENTER) 121.75 (OBND) 121.9 (IBND)	CLNC DEL 121.6	CPDLC
--	--	-------------------------------------	--	---	--------------------------	-------

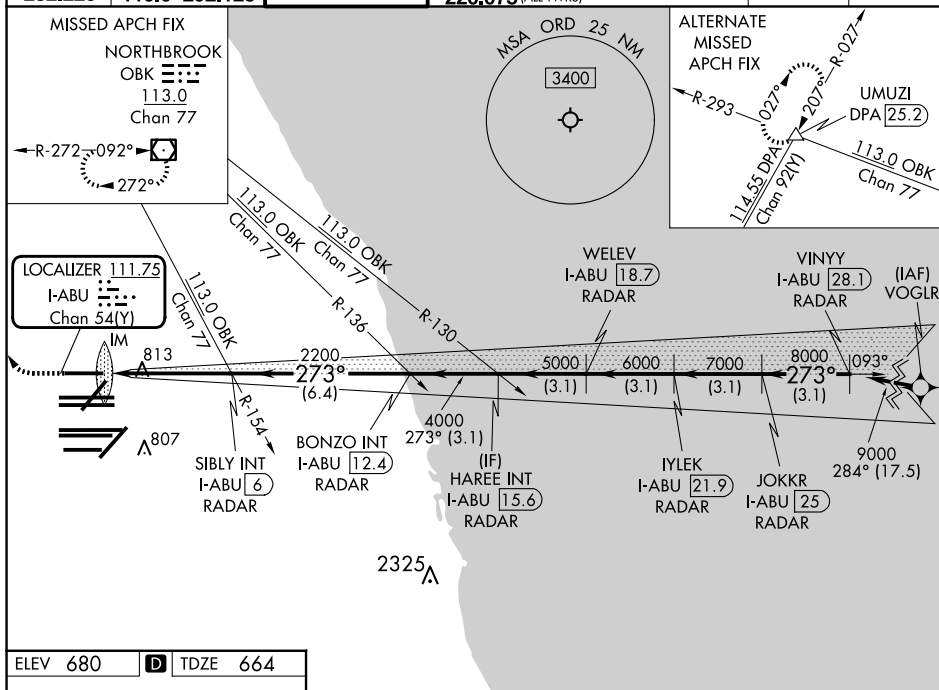

ELEV 680	D	TDZE 664
----------	----------	----------

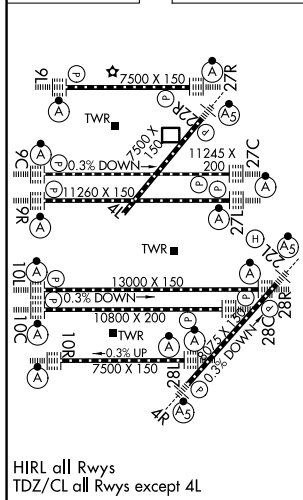

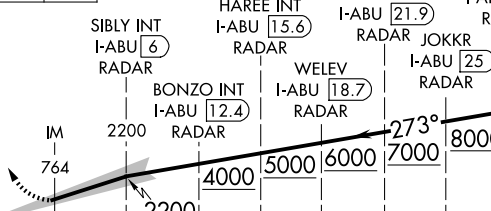1100	4000	OBK										
												
												
CATEGORY	A		B			C			D			
S-ILS-27R	CAT II RA 101/12 100 DA 764											
S-ILS-27R	CAT III RVR 06											

CATEGORY II & III ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

CHICAGO O'HARE INTL (ORD)

41°59'N-87°54'W

ILS RWY 27R (CAT II & III)