

LOC I-JAN	APP CRS	Rwy Ldg	8500
110.5	159°	TDZE	312
		Apt Elev	346

ILS RWY 16L (SA CAT I)
JACKSON-MEDGAR WILEY EVERS INTL (JAN)


⚠ When control tower closed, procedure NA.
⚠ When local altimeter setting not received, procedure NA.
ASR Requires specific OPSPEC, MSPEC, or LOA approval and use of HUD TO DA.

ALSF-2

A

MISSED APPROACH: Climb to 800 then climbing left turn to 3000 on heading 090° and on MHZ VORTAC R-134 to RAKIN INT/16.5 DME and hold, continue climb-in-hold to 3000.

ATIS 121.05	JACKSON APP CON ★ 123.9 317.7	JACKSON TOWER ★ 120.9 (CTAF) 0 352.0	GND CON 121.7 348.6	UNICOM 122.95
----------------	----------------------------------	--	------------------------	------------------

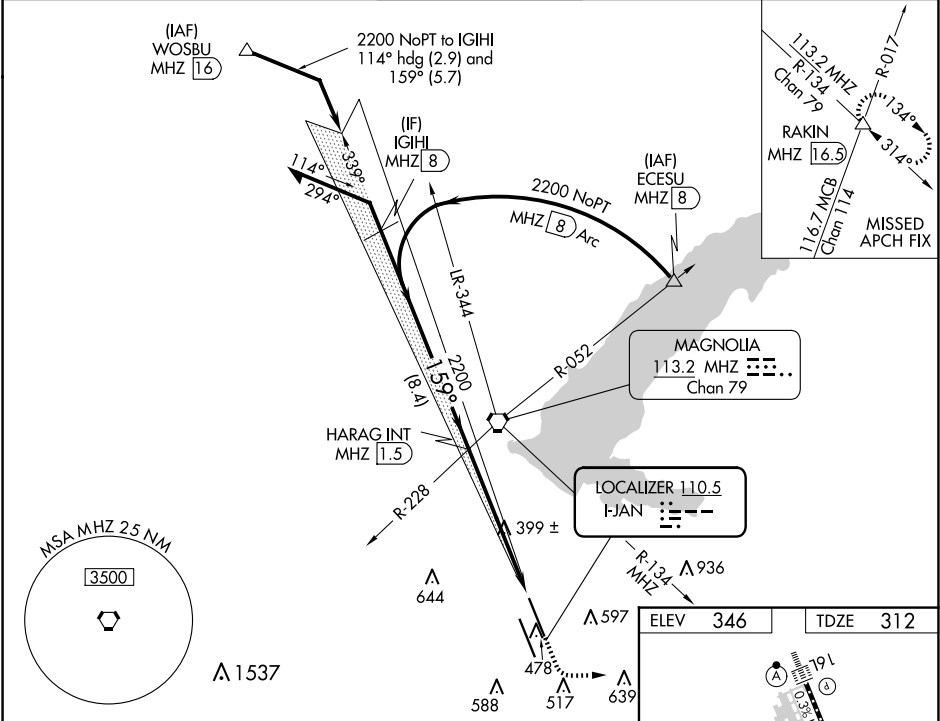

Remain within 10 NM

HARAG INT MHZ 1.5

2200

339°

159°

GS 3.00° TCH 55

5.8 NM

1051'

800

3000

hdg 090°

MHZ R-134

RAKIN

TDZ/CL Rwy 16L and 34L

REIL Rwy 16R and 34R

HIRL Rwy 16L-34R and 16R-34L

SA CATEGORY I ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

SC-4, 30 OCT 2025 to 27 NOV 2025

SC-4, 30 OCT 2025 to 27 NOV 2025