

YIGO, GUAM I, GUAM

TACAN Z RWY 24R


TACAN UAM Chan 54	APCH CRS 231°	Rwy Idg TDZE Arprt Elev	10,527 617 617
----------------------	------------------	-------------------------------	----------------------

(USAF)

ANDERSEN AFB (PGUA)

RADAR or DME required	ALSF-1	MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold.
▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile. ** Circling not authorized NW of Rwy 06L-24R.	A1	

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

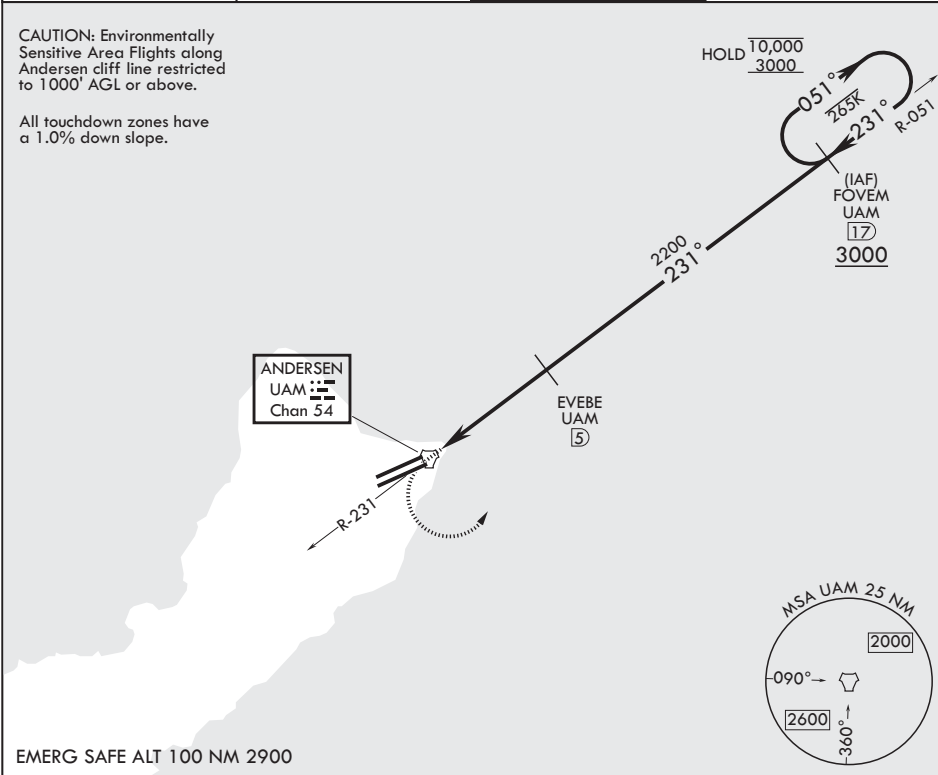

1100 UAM R-051	FOVEM UAM 17	VGSI and ILS glidepath not coincident (VGSI angle 3.00/TCH 59).	FOVEM 17	ELEV 617	TDZE 617																		
<table><tr><td>CATEGORY</td><td>A</td><td>B</td><td>C</td><td>D</td><td>E</td></tr><tr><td>S-24R*</td><td>940/24 323 (400-½)</td><td>940/40 323 (400-¾)</td><td>940/40 323 (400-¾)</td><td>940/40 323 (400-¾)</td><td>940/40 323 (400-¾)</td></tr><tr><td>CIRCLING**</td><td>1060-1 443 (500-1)</td><td>1080-1 463 (500-1)</td><td>1240-1¼ 623 (700-1¼)</td><td>1240-2 623 (700-2)</td><td>1240-2¼ 623 (700-2¼)</td></tr></table>						CATEGORY	A	B	C	D	E	S-24R*	940/24 323 (400-½)	940/40 323 (400-¾)	940/40 323 (400-¾)	940/40 323 (400-¾)	940/40 323 (400-¾)	CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)
CATEGORY	A	B	C	D	E																		
S-24R*	940/24 323 (400-½)	940/40 323 (400-¾)	940/40 323 (400-¾)	940/40 323 (400-¾)	940/40 323 (400-¾)																		
CIRCLING**	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1¼ 623 (700-1¼)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)																		
HIRL all rwys																							

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 2 17JUN21
TERPS

TACAN Z RWY 24R

PAC, 27 NOV 2025 to 22 JAN 2026

PAC, 27 NOV 2025 to 22 JAN 2026