
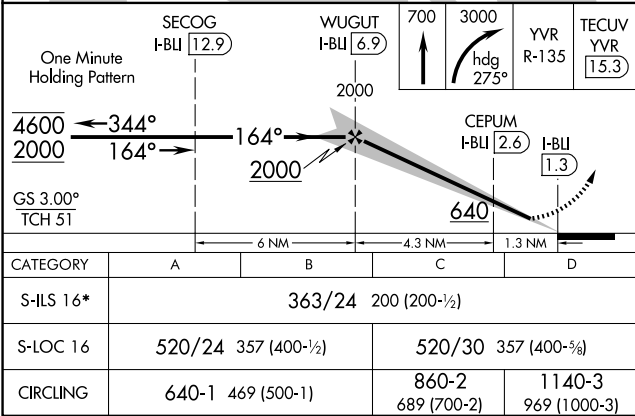


LOC/DME I-BLI 108.5 Chan 22	APP CRS 164°	Rwy Ldg TDZE 163 Apt Elev 171
---	------------------------	---

ILS or LOC RWY 16
BELLINGHAM INTL (BLI)

DME required.	MALSR	MISSED APPROACH: Climb to 700 then climbing right turn to 3000 on heading 275° and on YVR VOR/DME R-135 to TECUV/YVR 15.3 DME and hold.
V Autopilot coupled approach NA below 500. For inop ALS, increase S-LOC Cat C/D visibility to RVR 6000. *RVR 1800 authorized with use of FD or AP or HUD to DA.		

ATIS 134.45	VICTORIA TERMINAL APP CON 132.7	BELLINGHAM TOWER ★ 124.9 (CTAF) 0 379.3	GND CON 127.4 379.3	UNICOM 122.95
-----------------------	---	--	-------------------------------	-------------------------

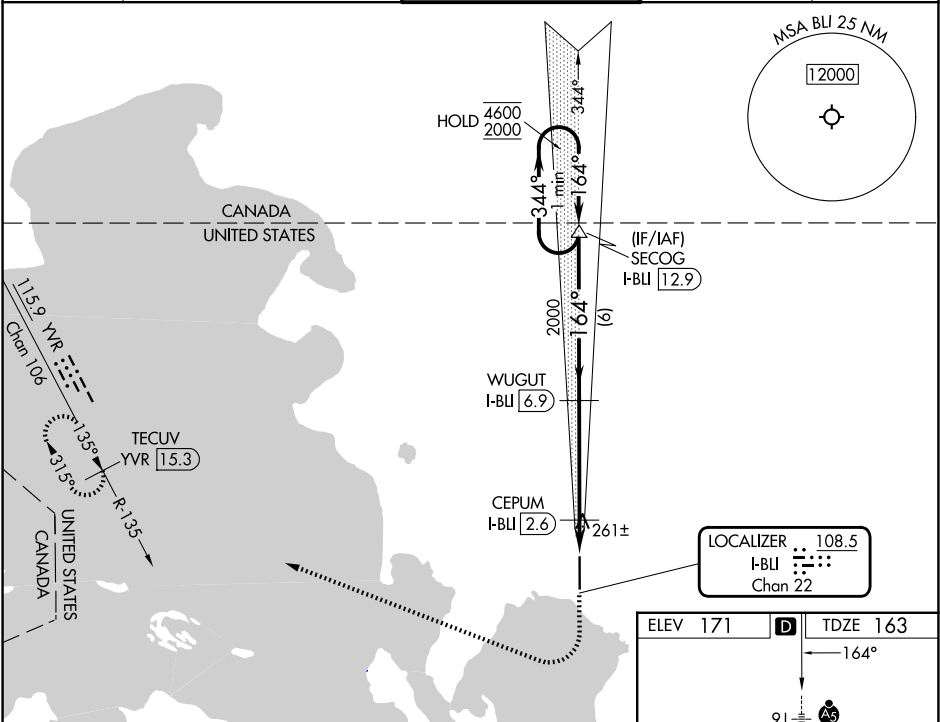

ELEV 171	D	TDZE 163
164°		
91		
6700 X 150		
34		
TWR		
REIL Rwy 34 0		
HIRL Rwy 16-34 0		

BELLINGHAM INTL (BLI)
ILS or LOC RWY 16