


WAAS CH 90324 W34A	APP CRS 342°	Rwy Idg 5332 TDZE 135 Apt Elev 142
--	------------------------	---

RNAV (GPS) RWY 34

ARLINGTON MUNI (A WO)

RNP APCH-GPS.		MALS	MISSED APPROACH: Climb to 1000 then climbing left turn to 2000 direct SAVOY and hold.
⚠ Inop table does not apply to LPV. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1½ SM and LNAV Cat C and D visibility to 1½ SM.		Ⓜ	

AWOS-3PT 135.625	SEATTLE APP CON 128.5 306.9	CLNC DEL 121.725	CTAF 122.725 0
----------------------------	---------------------------------------	----------------------------	--------------------------

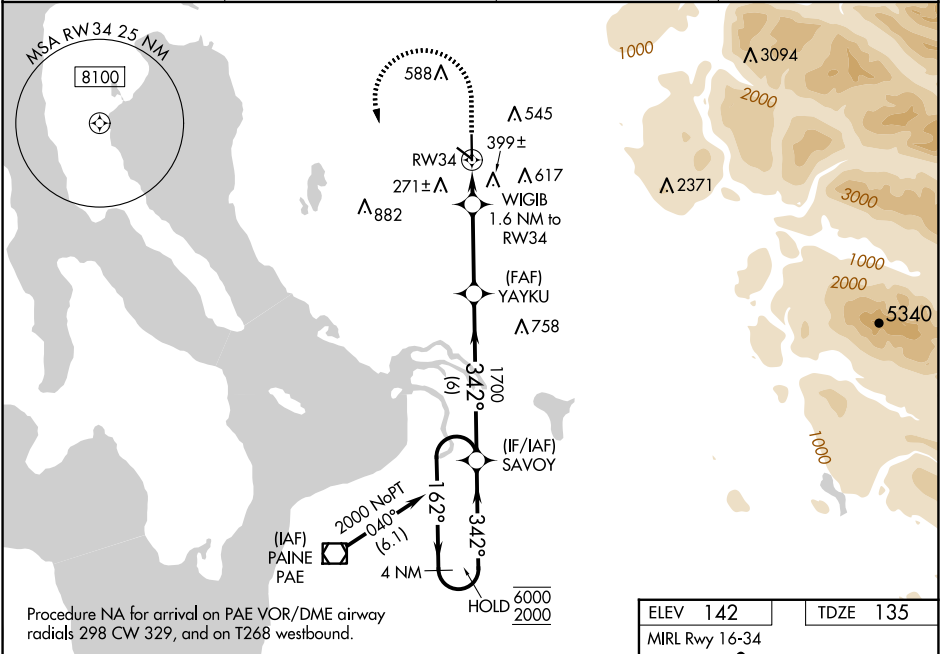

1000

↑

2000

↷

SAVOY

✦

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 36).

YAYKU

SAVOY

4 NM Holding Pattern

162°

342°

6000

2000

GP 3.00°

TCH 46

WIGIB

1.6 NM to RW34

680

1700

342°

1700

RW34

1.6 NM

3.2 NM

6 NM

CATEGORY	A	B	C	D
LPV DA	335-¾ 200 (200-¾)			
LNAV/VNAV DA	510-¾ 375 (400-¾)			
LNAV MDA	540-¾ 405 (400-¾)	540-1 405 (400-1)		
CIRCLING	840-1	900-1	1000-2½	1040-3
	698 (700-1)	758 (800-1)	858 (900-2½)	898 (900-3)

