

APP CRS 173°	Rwy Ldg 12000 TDZE 5339 Apt Elev 5434
------------------------	--

RNAV (RNP) Z RWY 17L
DENVER INTL (DEN)




V GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to RVR 4500 and RNP 0.30 all Cats visibility to RVR 6000. Simultaneous approach authorized. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For uncompensated Baro-VNAV systems, procedure NA below -25°C (-13°F) or above 48°C (118°F).

MALSR


MISSED APPROACH: Climb to 5900 then climbing left turn to 10000 direct LIMEX and hold.

D-ATIS 125.6 379.9	DENVER APP CON 119.3 307.3 (N) 120.35 379.3 (S)	DENVER TOWER 132.35 239.275	GND CON 121.35 379.175 (W) 121.85 377.1 (E)
------------------------------	---	---------------------------------------	---


RADAR REQUIRED

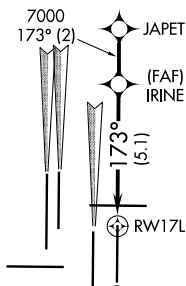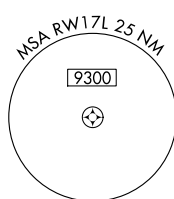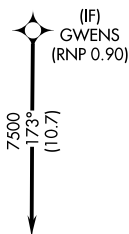

ELEV 5434		TDZE 5339
-----------	---	-----------

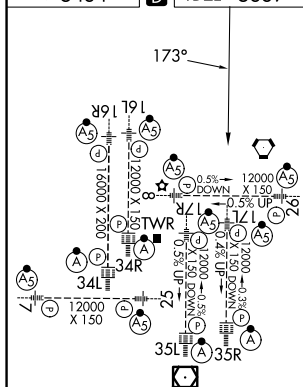

HIRL all Rwy's
TDZ/CL Rwy's 7, 16L, 16R, 17R,
26, 34L, 34R, 35L, 35R

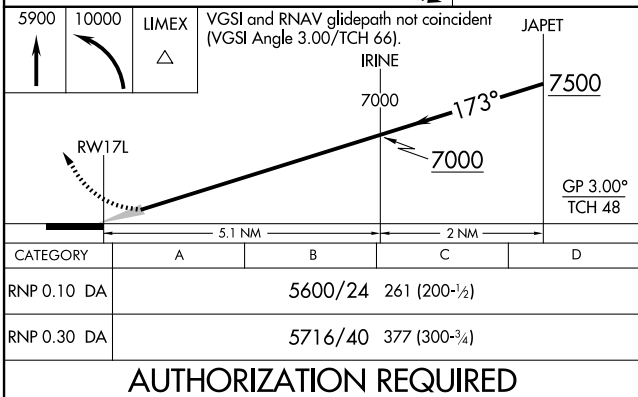

DENVER, COLORADO

Orig-C 01FEB18

DENVER INTL (DEN)

39°52'N-104°40'W

RNAV (RNP) Z RWY 17L