

ROGUE VALLEY INTL/MEDFORD (See MEDFORD on page 192)**ROME STATE** (REO)(KREO) 20 SW UTC-8(-7DT) N42°34.66' W117°53.13'

KLAMATH FALLS

4053 NOTAM FILE REO

RWY 03-21: 6000X150 (GRVL)**AIRPORT REMARKS:** Unattended. Sage growing in primary sfc. Rwy 03-21 sagebrush growing on west portion of rwy. Rwy 03-21 ltd by arpt opr to 8000 lbs single wheel gear. Sfc conds not rptd.**AIRPORT MANAGER:** 503-378-4880**COMMUNICATIONS:** CTAF 122.9**RCO** 122.2 (BOISE RADIO)**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Salt Lake ARTCC at 801-320-2568.**RADIO AIDS TO NAVIGATION:** NOTAM FILE REO.**(VH) (DH) VORW/DME** 112.5 REO Chan 72 N42°35.43' W117°52.09' 206° 1.1 NM to fld. 4040/19E.

DME unusable:

095°-105° byd 30 NM blo 10,000'

115°-125° byd 30 NM blo 10,000'

VOR unusable:

011°-021° byd 40 NM

044°-054° byd 40 NM blo 31,000'

055°-119° byd 40 NM

120°-130° byd 40 NM blo 29,000'

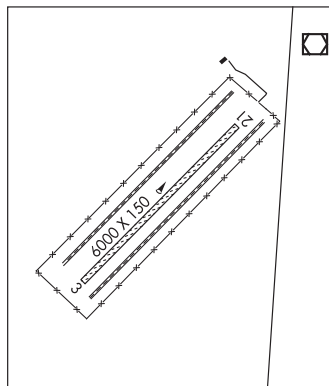
131°-179° byd 40 NM

180°-190° byd 40 NM blo 19,000'

191°-214° byd 40 NM

225°-303° byd 40 NM

304°-315° byd 40 NM blo 18,000'

**ROSEBURG****GEORGE FELT** (5S1) 3 W UTC-8(-7DT) N43°12.93' W123°24.26'

KLAMATH FALLS

428 NOTAM FILE MMV

RWY 10-28: 2300X100 (TURF) 0.4% up E**RWY 10:** Tree.**RWY 28:** Brush. Rgt tfc.**NOISE:** For NS ABTMT fly to river before turning.**AIRPORT REMARKS:** Attended irregularly. Deer frequently on rwy. Migratory flocks of waterfowl on and invof arpt. Soft earth off rwy and twy when wet. Monitor Roseburg Rgnl CTAF/UNICOM for conflicting acft. Rwy 28 4' fence at 30' crossing apch. Rwy 10 +25' trees at 50' from cntrln both sides.**AIRPORT MANAGER:** 541-673-7709**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Seattle ARTCC at 253-351-3694.